Sanitized Copy Approved for Release 2011/08/08: CIA-RDP78-03300A001100040012-1

To:	August 1, 1961 25X
From:	25X
cc;	
Re:	
Attached, find copy of report by	25X
Reference is made to several items in the	is report.
states that on all, except more burned intercell straps. Had we she tally, it would appear as though all intercell straps were badly burned between that the short was internal and not	srcell straps would have burned. tteries and several of these an two cells only. This indi-
2. Any moisture accumulating within the leakage path to the case since the interior an inch shorter than spec. It the end cell which made direct metallic of	for sleeves are at least 3/8 This is obvious in the case of 25X
3. The leakage may also have been aggrav	
4. report apparently acknowld defects in the batteries, however, concluing damaged the seals. It is also noted the leakages which may get progressively	that humidity was the cause of
In view of the above, we are performing a these batteries before using them on our being discharged at a 3 ampere rate for a charged at its normal charging rate. This ten times.	equipment. The battery is ten minutes and then being re-
We are also advising the customer to checeither terminal to the case on a humid dacurrent. If this leakage current exceeds	my to determine the leakage
	188ume that the leakage path 25X 25X
1G*dto	25X
CONF. Sanitized Copy Approved for Release 2011/08/	INFNITI 08 : CIA-RDP78-03300A001100040012-1